

Round Oconto County Lakes Project

ROUND LAKE STUDY

SUMMARY REPORT

2023

Oconto County Lakes Project Reports:

**State of the
Oconto County
Lakes**

**Lake Study
Summary
Reports**

**Operational Strategy and
Plan for Surface Water
Management and
Protection**


**Lake
Management
Plans**



Center for Watershed Science and Education
College of Natural Resources
University of Wisconsin - Stevens Point

Background


- Round Lake is a 31-acre drainage lake in central Oconto County with a maximum depth of 31 feet.
- Most water enters Round Lake via a tributary wetland on the northwest side and leaves via a small channel on the south side leading to Kelly Lake. Groundwater, surface water runoff and direct precipitation also contribute water.
- Visitors have access to the lake from one public boat launch located on the lake's east side.
- This report summarizes data collected during the 2021-2022 lake study.

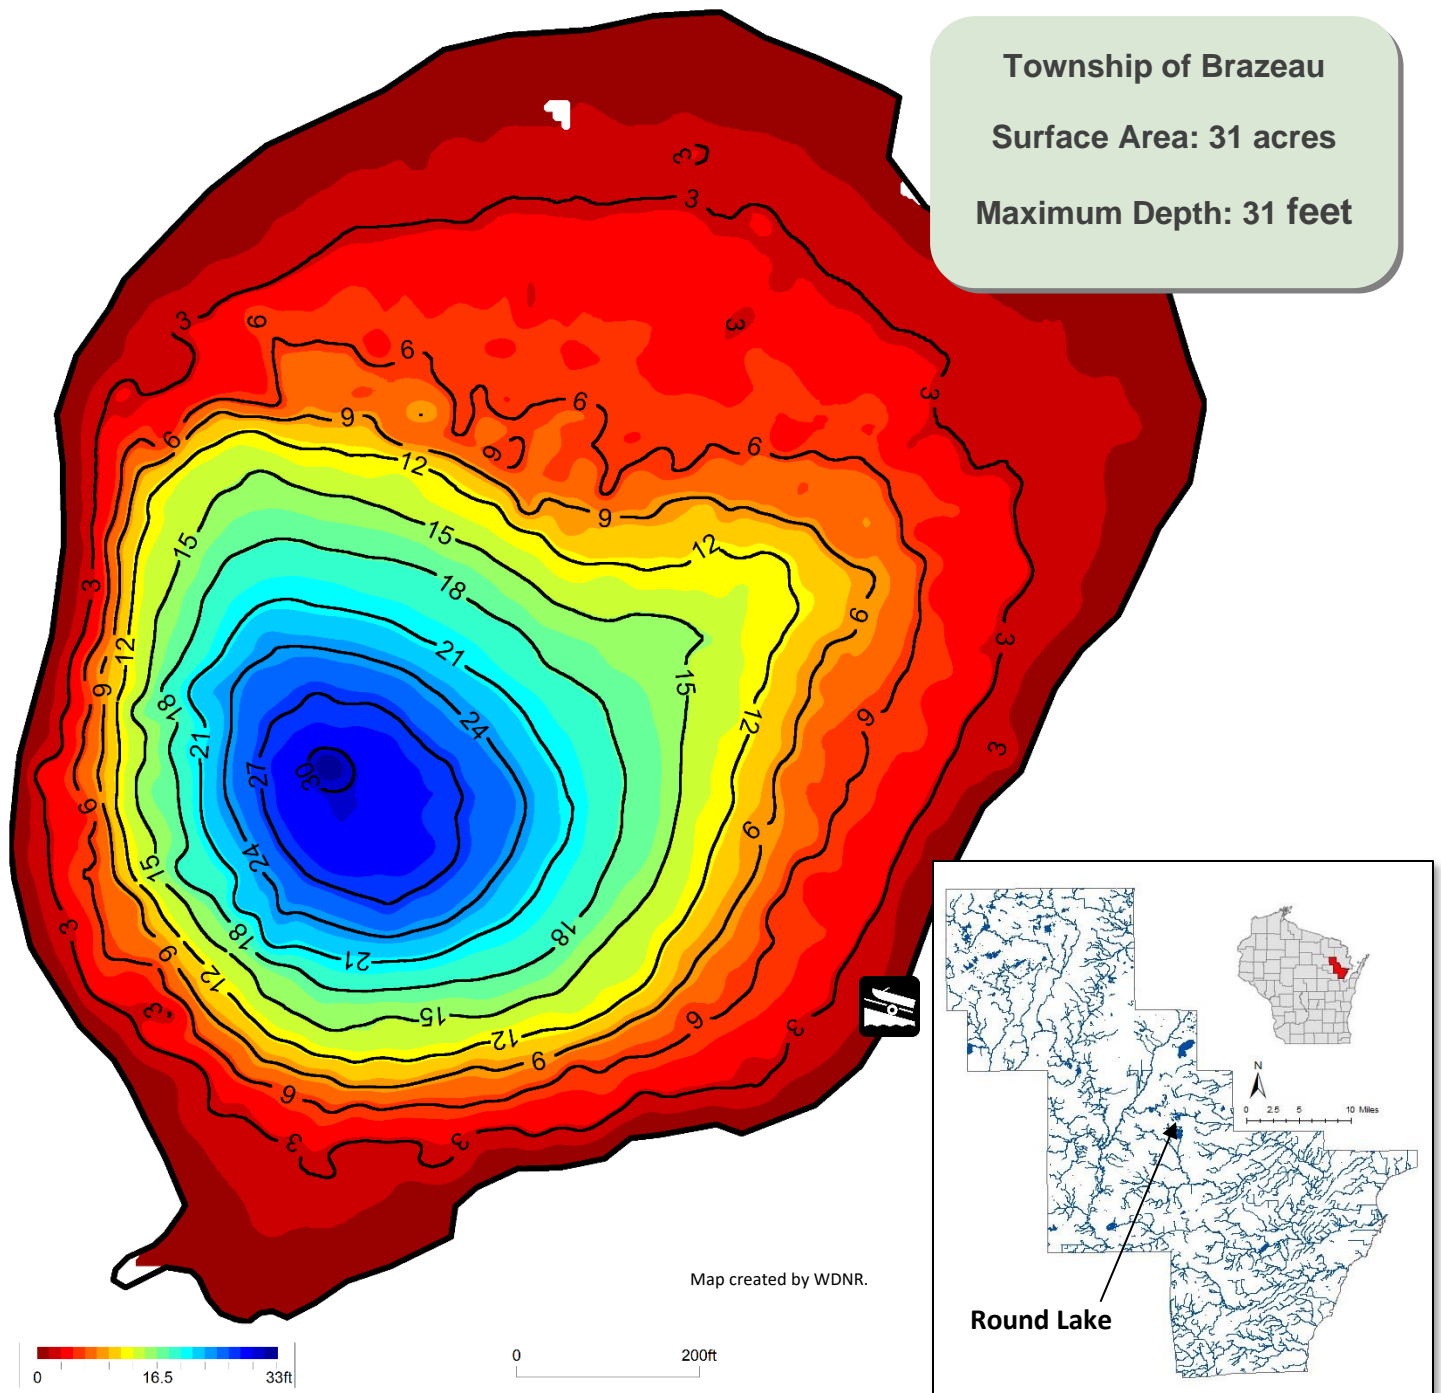

Water Quality


Nutrients such as phosphorus and nitrogen are what feed aquatic plants and algae in a lake. Excessive amounts of nutrients delivered to a lake will result in abundant plant and algae growth. Disturbance within a watershed combined with the landscape's inability to infiltrate and filter runoff is what primarily delivers nutrients to a lake.

- Total Phosphorus was consistently below the Wisconsin state standard of 30 $\mu\text{g/L}$ for deep drainage lakes during the two-year study. The limited dataset does not indicate a clear trend.
- Inorganic nitrogen remained below the threshold of 0.3 mg/L when algal blooms increase.
- Chlorophyll-a, an indirect measure of algae, remained below the threshold of 6 $\mu\text{g/L}$ throughout the study.

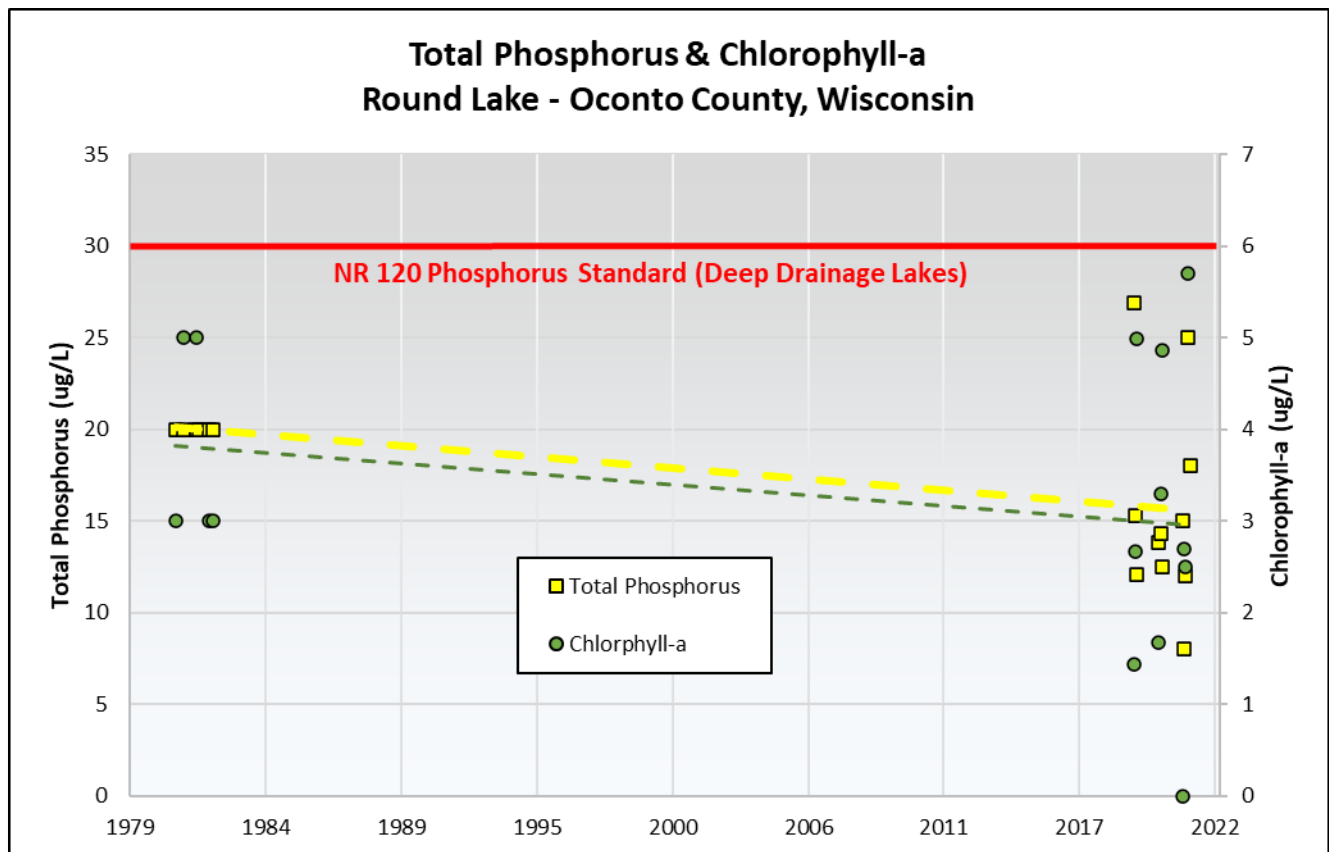

Water Quality


Sufficient **dissolved oxygen** in lake water is essential to the survival of aquatic organisms. The amount of dissolved oxygen present within a lake varies by season and depth. It is determined by the biological activity that consumes or produces oxygen, by water mixing through wind, changes in temperature, and inputs of surface and groundwater. Generally, at least 5 mg/L oxygen is required for fish.

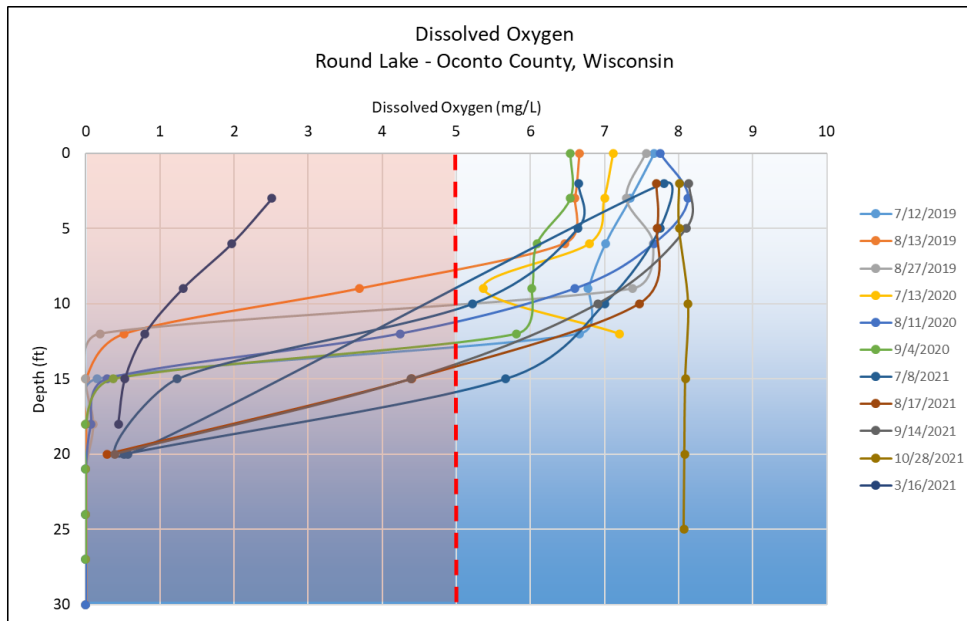


➤ Sufficient oxygen is available in the water column of Round Lake through most of the year but may become anoxic in late winter. Generally, the top 8 feet maintains enough oxygen to support most fish species.

Lake water **temperature** has a significant impact on water chemistry, spatial distribution of fish, microbial growth and oxygen content.

➤ Temperature profiles in Round Lake show stratification throughout the growing season, typical of a deep lake, as surface temperatures heat up in summer and bottom temperatures reflect cool groundwater inputs.


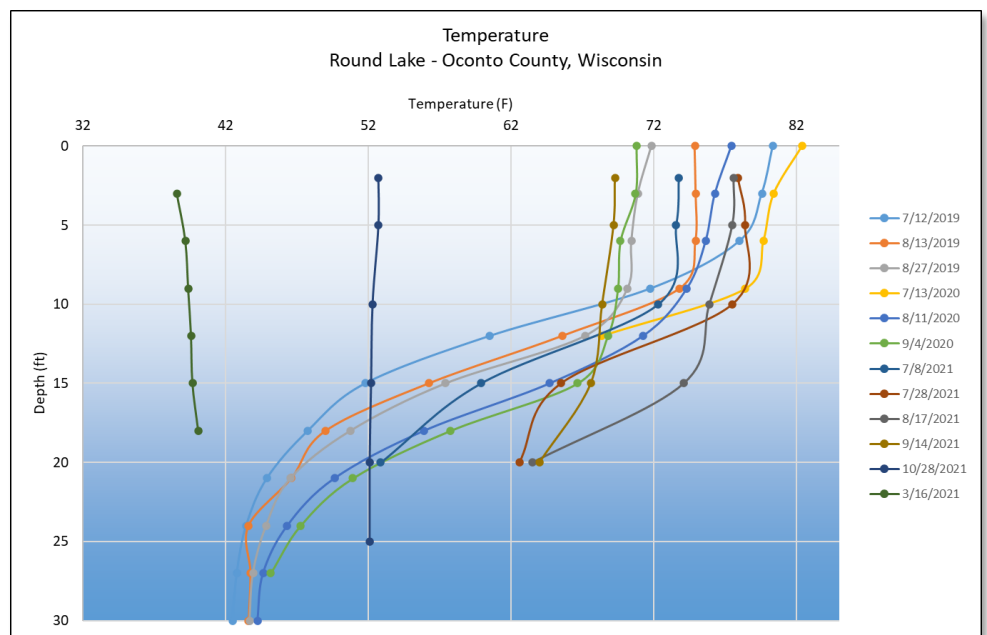


Water Quality

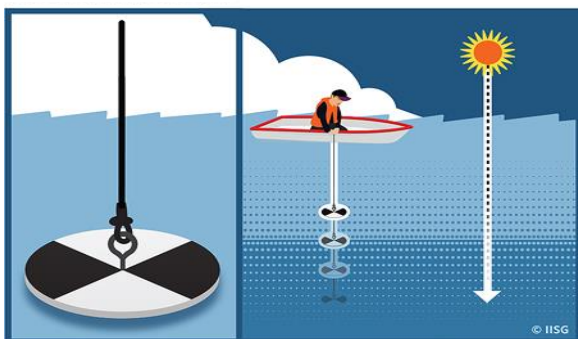

Water clarity is a measure of how deep light can penetrate (Secchi depth). Clarity is affected by water color, turbidity (suspended sediment), and algae. Water clarity helps determine where rooted aquatic plants can grow. It is typical for water clarity to vary throughout the year.

- The graphs below shows water clarity measurements taken between May and November.
- During 2021-22, the poorest average water clarity was in October and best was in September. Limited data suggests a stable trend.

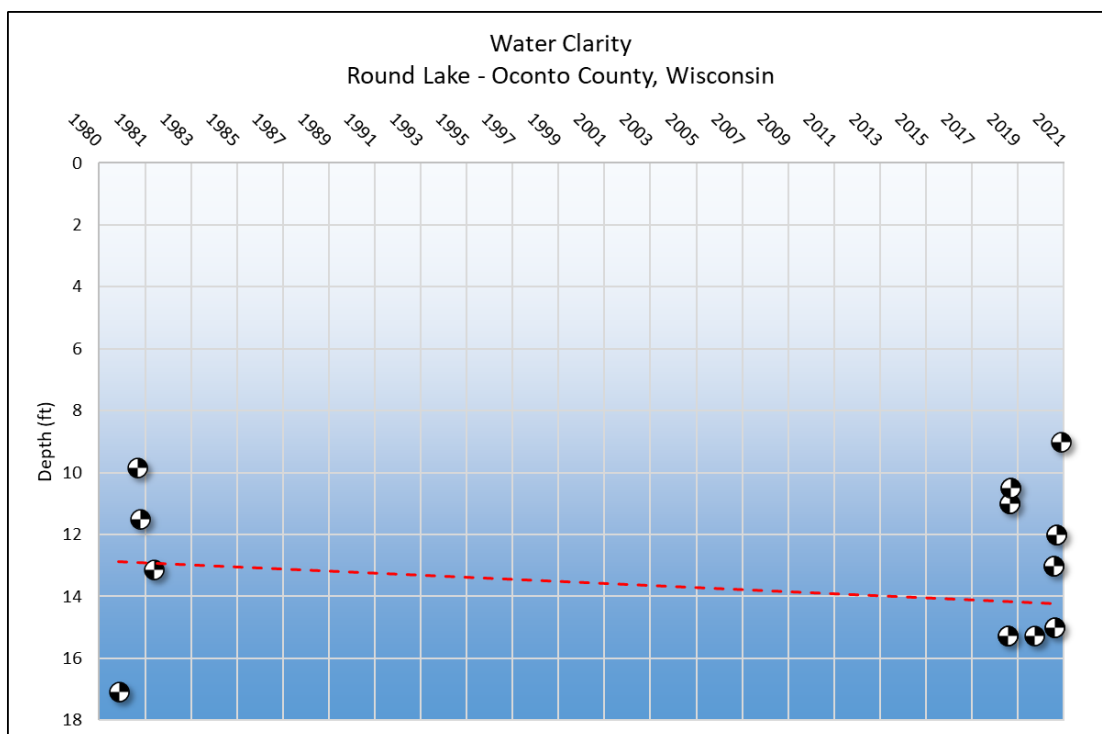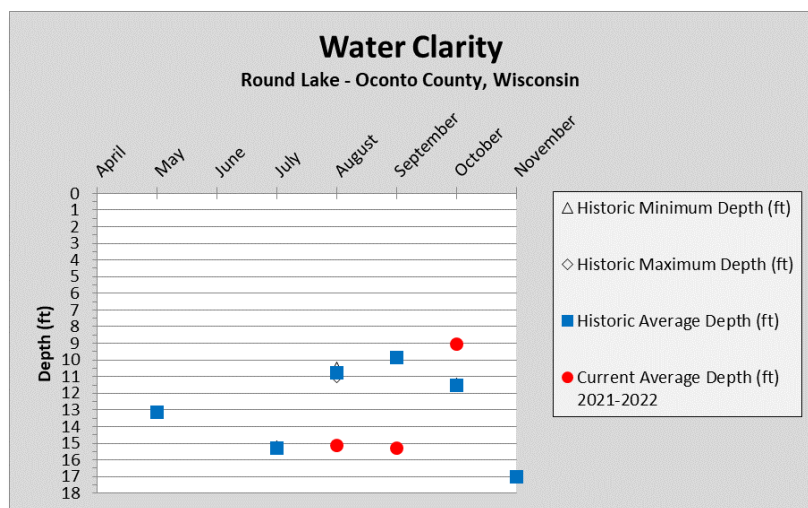

Water Quality

Other chemistry data was collected from lake water samples, such as basic cations, pollutants and acid rain input, and physical parameters. Results of such analyses can provide insights into a variety of other potential impacts to the lake. While concentrations of these compounds in lake water is usually low, higher concentrations can be indicators of other potential issues.

- Concentrations of potassium (0.69 mg/L), chloride (0.9 mg/L) and sodium (1.2 mg/L) were all low. This suggests minimal impact from septic systems, road salt, animal waste and fertilizers.
- DACT, a screening tool to determine if your lake is being impacted by pesticides, was not detected.
- Water in Round Lake is moderately hard (114 mg/L CaCO_3), having a slightly elevated level of dissolved minerals. These minerals tend to bind with phosphorus making it unavailable to algae blooms.




For more information on how to interpret your lake's water quality data, please refer to the "State of the Oconto County Lakes Report" that is on file with Oconto County.

Groundwater provides water to lakes in Oconto County throughout the entire year. Hard surfaces on the landscape prevent water from soaking into the ground and becoming groundwater. This results in less water flowing to the lake during snowmelt and rain events. Water that does not infiltrate to groundwater becomes **surface runoff** flowing across the surface of the landscape where it can move sediment and contaminants to the lake from within its watershed.



Round Lake (Brazeau) Surface Watershed & Groundwater Flow

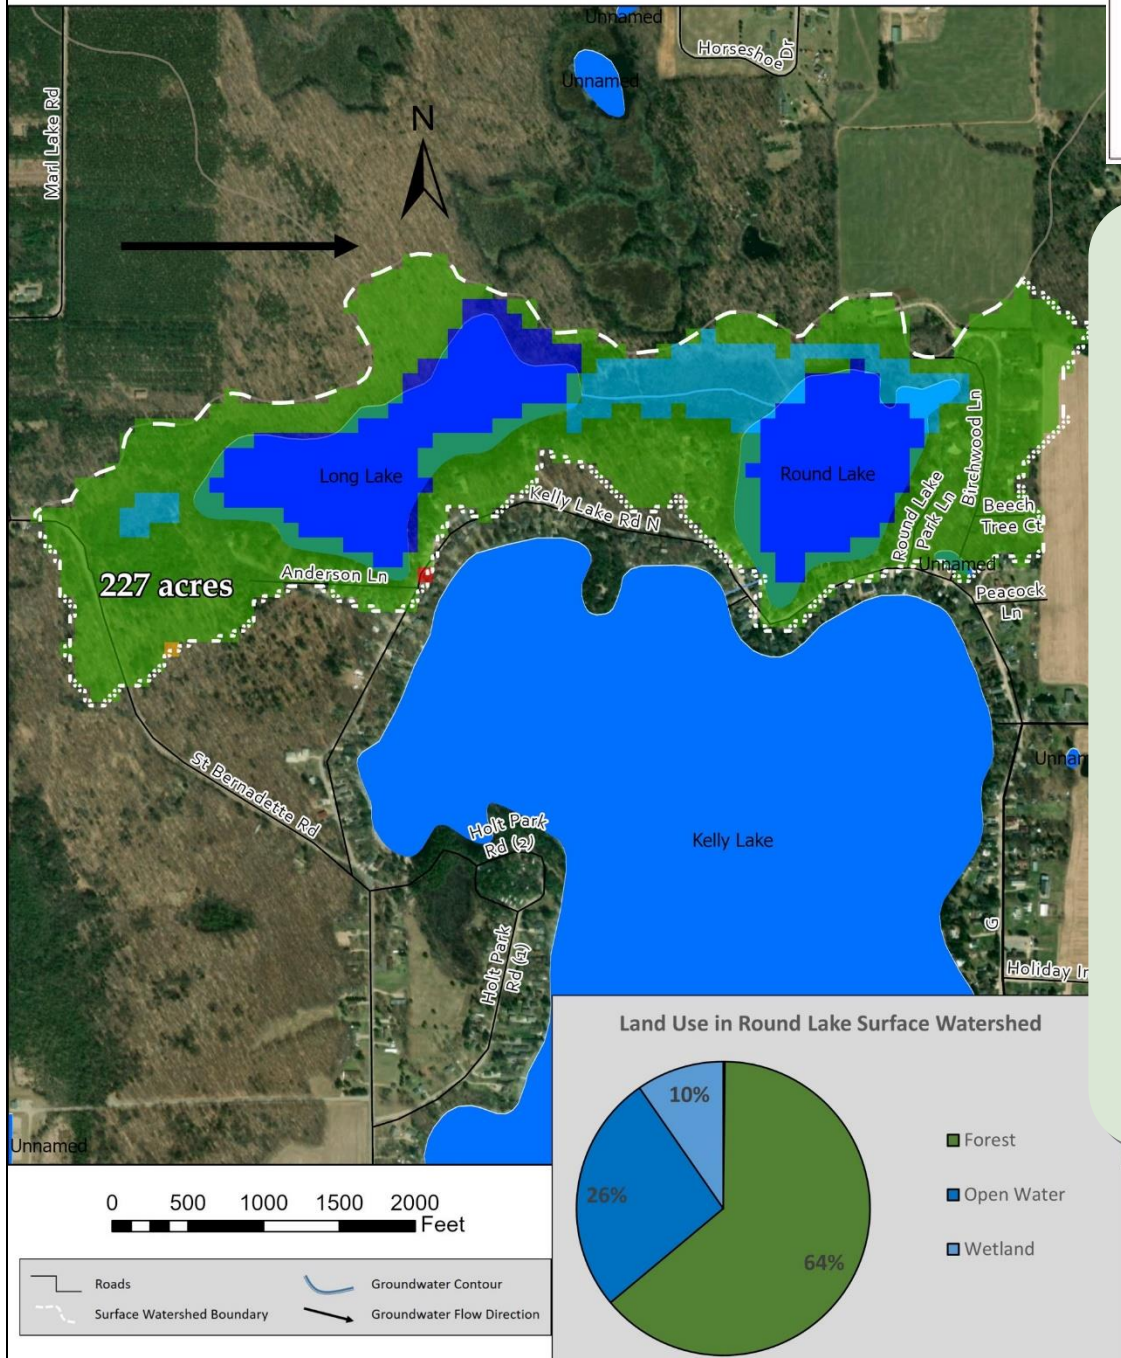

The quality of lake water reflects what is happening on the land surface. Precipitation falling on forests produces clean groundwater, whereas precipitation falling on land that has chemical use can produce runoff and groundwater that contains these chemicals. Groundwater contamination may include nitrogen, pesticides, herbicides and other soluble chemicals originating from septic systems, crops, barnyards, and road de-icing. Once in the groundwater, these chemicals move slowly towards a lake or river.

Shorelands

Shoreland vegetation is critical to a healthy lake's ecosystem. It provides habitat for many aquatic and terrestrial animals including birds, frogs, turtles, and many small and large mammals. It also helps to improve the quality and quantity of the runoff that flows across the landscape towards the lake. Healthy shoreland vegetation includes a mix of tall, native grasses/flowers, shrubs and trees.

- Shorelands around Round Lake were surveyed in July 2021. Many shoreland areas are healthy, but some stretches are in need of restoration.


Total lakefront footage	No. Riparian lots	Measured shoreland disturbance (feet)	Measured shoreland disturbance (%)
4,246	39	1,538	36%



State Shoreland Zoning Ordinance NR 115 Wisc. Adm. Code for Unincorporated Municipalities


No vegetation within 35 feet of the lake's edge shall be removed except for:

- Up to 30% of shoreline may be removed of shrubs and trees for a view corridor
- A mowed or constructed pedestrian path up to 5 feet wide to access lake

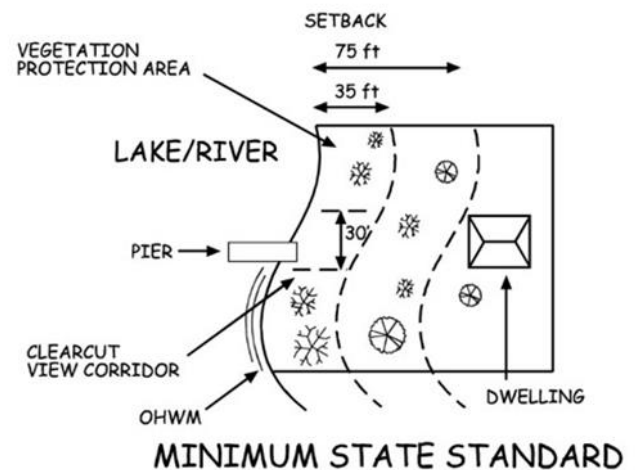

What Can You Do To Help Round Lake?

- ✓ Leave natural shoreland vegetation in place or restore if it has been removed.
- ✓ Learn to identify and look for invasive plants and animals and know who to contact if found.
- ✓ Do not purchase prohibited and restricted species. Purchase native plants when possible.
- ✓ Never transplant water garden or aquarium plants into lakes, streams or wetlands. Properly dispose of them.
- ✓ Remove invasive exotic plants from your landscape and replace them with native plants or non-invasive exotics. Scout regularly for new invasive plants.
- ✓ Avoid using garden plants from other regions whose invasive potential is poorly understood.

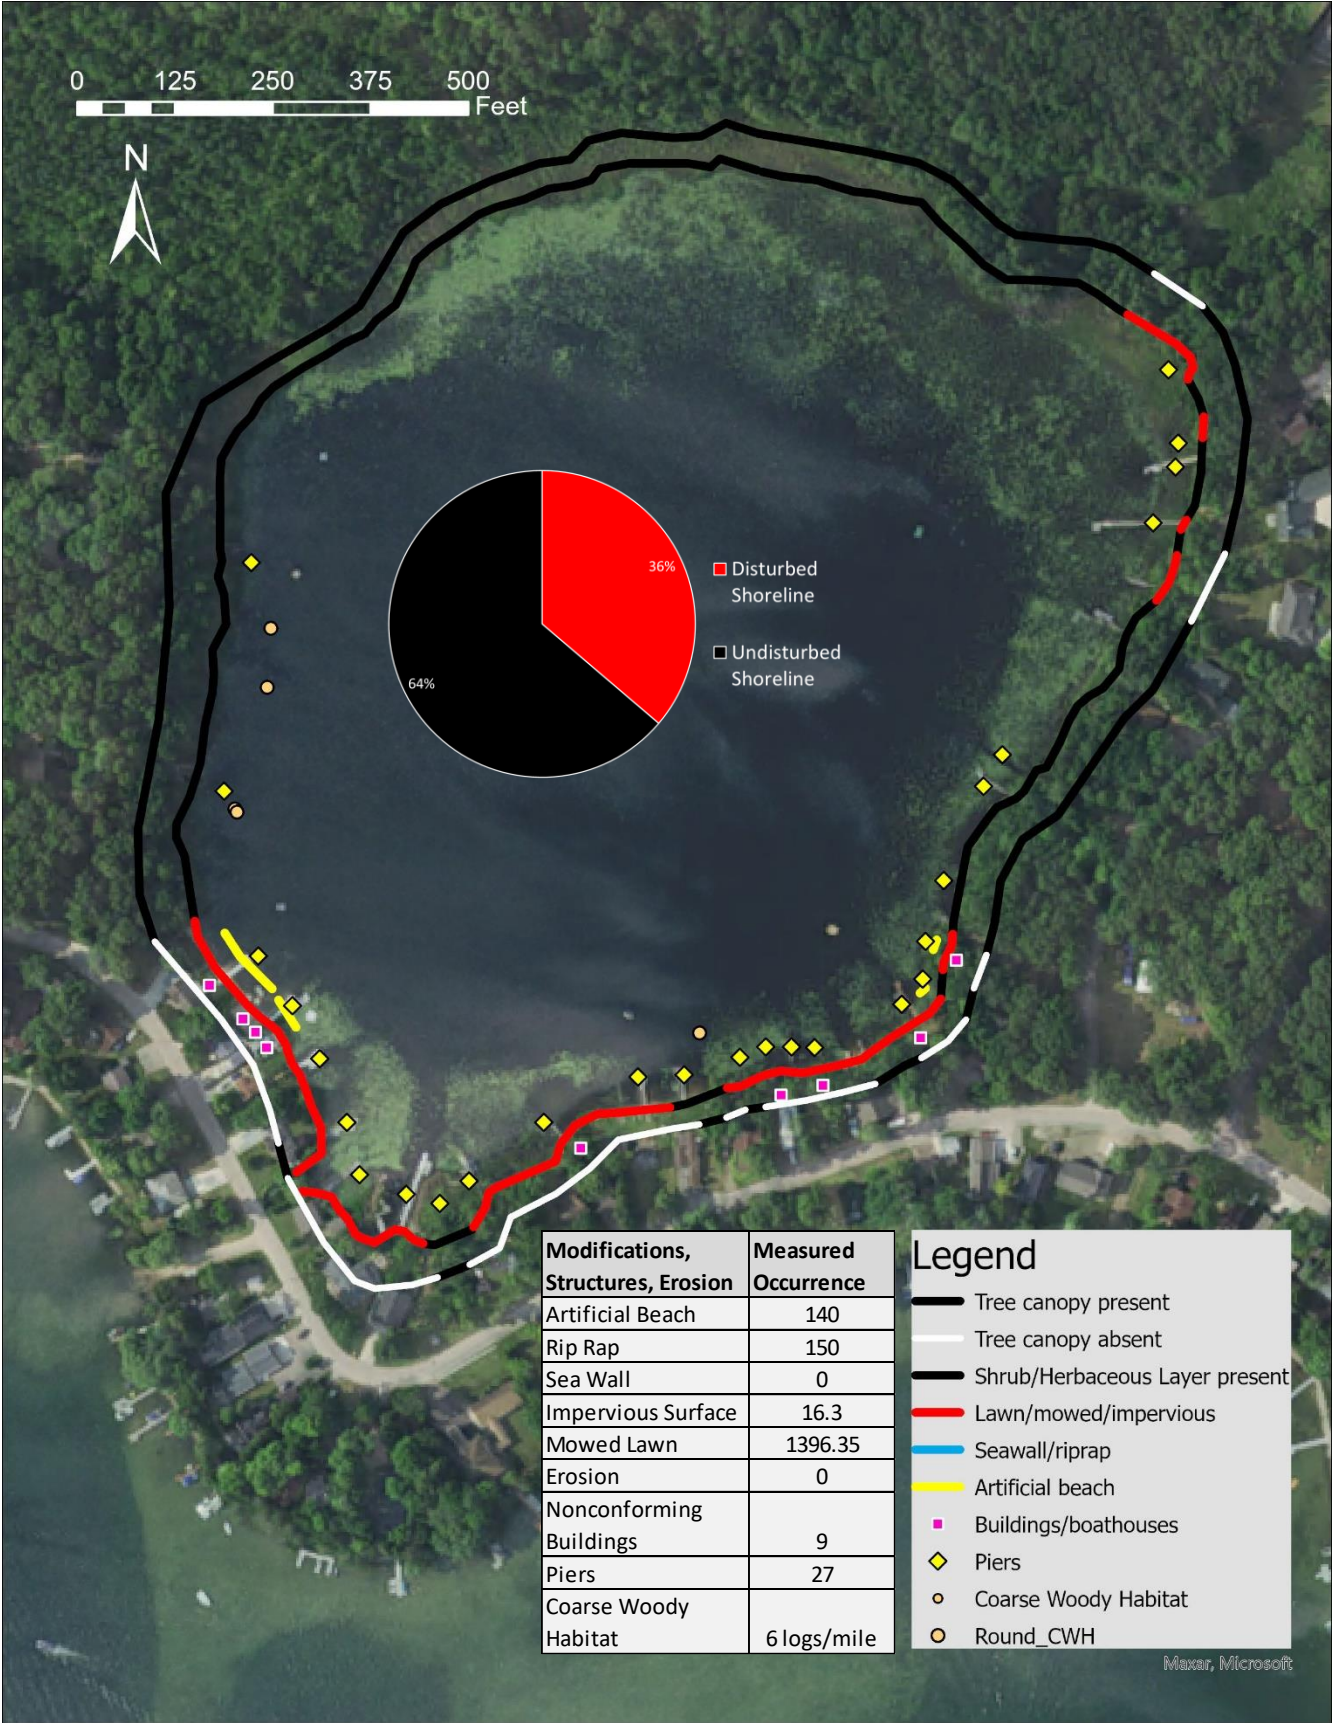


Aquatic Plants

Aquatic plants are the forest landscape within a lake. They provide food and habitat for terrestrial and aquatic creatures such as fish, ducks, turtles, invertebrates and other animals. They increase oxygen levels in the water and utilize nutrients that would otherwise be used by algae. A healthy lake typically has a variety of aquatic plant species creating diversity that can help to prevent the establishment of aquatic invasive species.

- The aquatic plant community in Round Lake is characterized by above average diversity of plant species when compared to other lakes in the Oconto County Lakes Project, with a total of 24 species in the 2021 survey.
- During the 2021 aquatic plant survey of Round Lake, 82% of visited sites had vegetative growth. The maximum depth of vegetation was 16 feet and the Floristic Quality Assessment (FQI) was 30.8.
- The most frequently encountered plant species were large purple bladderwort (40%), Eurasian water-milfoil (34%), chara (33%), and white water lily (31%).
- Eurasian water-milfoil is an invasive species in Wisconsin.

Round Lake Aquatic Plant Survey 2021:
Rake Fullness

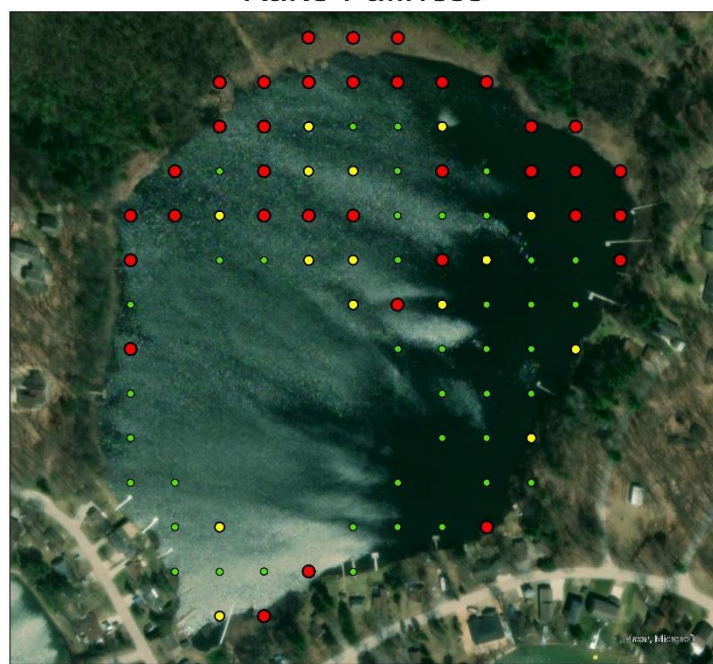

Center for Watershed Science and Education
College of Natural Resources
University of Wisconsin-Stevens Point

Rake Fullness

- 1
- 2
- 3



Round Lake Aquatic Plant Survey 2021:
Total Number of Species



Center for Watershed Science and Education
College of Natural Resources
University of Wisconsin-Stevens Point


Total Number of Species

- 1-3
- 4-7
- 8+



Aquatic Plants


Round Lake Aquatic Plant Survey 2021: Large purple bladderwort (*Utricularia purpurea*)

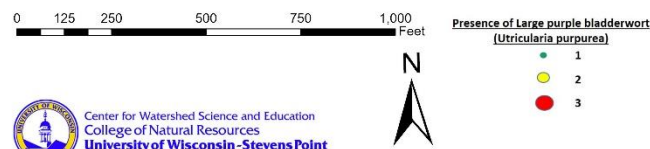

Coontail lacks roots and can form dense mats just below the surface. It is usually in calm, nutrient-rich water and provides habitat for young fish and other aquatic animals. Waterfowl will eat the seeds and foliage.



Round Lake Aquatic Plant Survey 2021: Muskgrass (*Chara* spp.)

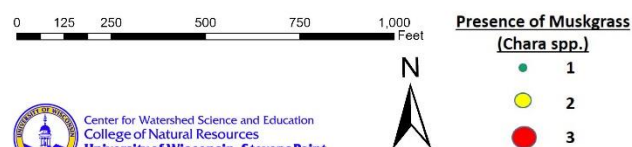


Chara is a type of macro algae that grows attached to muddy lake bottoms and has a musky odor. Muskgrass, as it is known, filters the lake water and is helpful in preventing the establishment of invasive species.



Aquatic Plants


Round Lake Aquatic Plant Survey 2021: White water-lily (*Nymphaea odorata*)

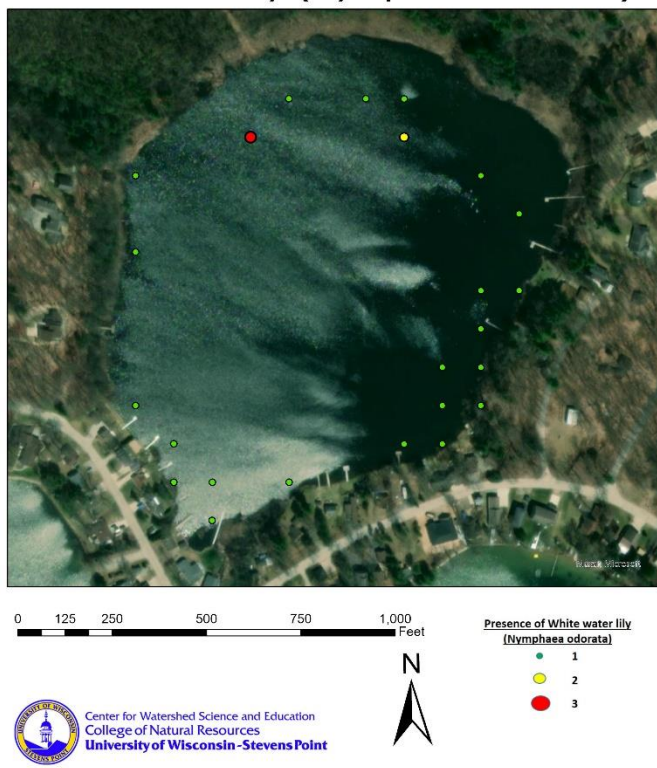

White water lily has round stalks that grow up from a rhizome in the sediment connecting to large round floating leaves. By mid-summer, white flowers also float at the surface. Lilies are important cover for fish, are food by many species, and help prevent erosion by slowing wave action.



Round Lake Aquatic Plant Survey 2021: Eurasian water-milfoil (*Myriophyllum spicatum*)

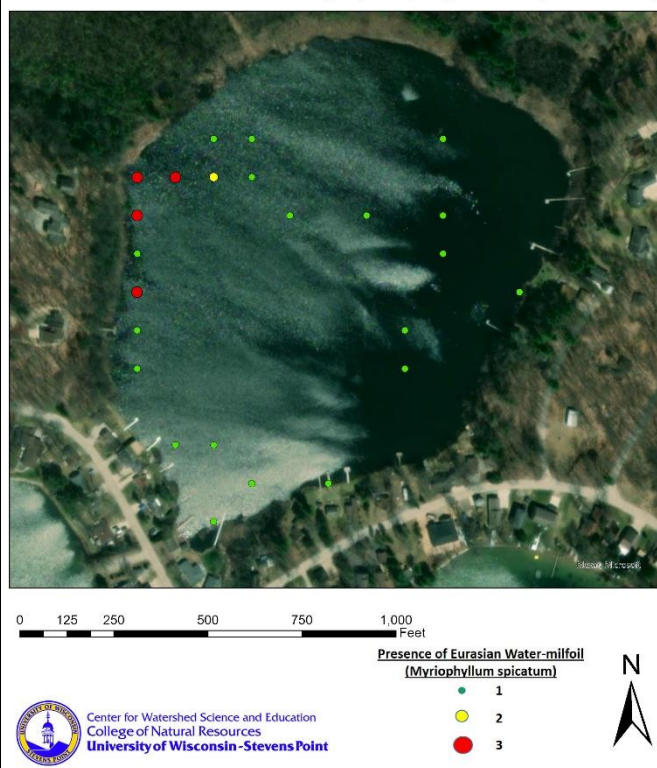

Eurasian watermilfoil is one of the most common invasive aquatic plants in Wisconsin. It can form dense mats that choke out native plants and inhibit navigation. New plants can grow from stem fragments that root on contact with the substrate.



Acknowledgments

Aquatic **invasive species** are non-native aquatic plants and animals that are most often unintentionally introduced into lakes by lake users. In some lakes, aquatic invasive plant species can exist as a part of the plant community, while in other lakes populations explode, creating dense beds that can damage boat motors, make areas non-navigable, inhibit activities like swimming and fishing, and disrupt the lakes' ecosystems.

- Eurasian water-milfoil, first documented in Round Lake in 2012, was observed at 34% of sites in the 2021 aquatic plant survey. Hybrid Eurasian/Northern water-milfoil was confirmed in 2019.

*This report was prepared as an appendix to the **Oconto County State of the Lakes Report**, which is on file with the Oconto County Land Conservation Department.
Written and prepared by the Center for Watershed Science and Education at the University of Wisconsin-Stevens Point.*

Primary Authors

Ryan Haney and Paul McGinley

Acknowledgments

We are grateful to our project partners for supporting this project by providing insight, enthusiasm, and funding:

Oconto County Lakes and Waterways Association

Oconto County Land Conservation Department – Ken Dolata

Oconto County Staff and Citizens

UW Extension-Oconto County – Dale Mohr

Wisconsin Department of Natural Resources – Brenda Nordin & Brian Zalay

Wisconsin Department of Natural Resources Lake Protection Grant Program

UW-Stevens Point Water and Environmental Analysis Lab



Center for Watershed Science and Education
College of Natural Resources
University of Wisconsin-Stevens Point

